

Ref:(29) in T.B.M. 713/50

Tel: Muar. 23.

MEMORANDUM

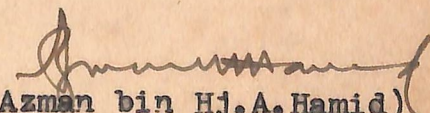
From: SECRETARY
TOWN BOARD, MUAR.
16th Dec., 1952.

To: The Hon: Secretary,
Chang Hwa High School Building com
18 Jalan Sayang, Muar.

=====
Sub:- Chung Hwa High School at Jalan Junid.

I regret to say that the supervision on the R.C. work is slackened.

2. Rodding the concrete with timber piece and putting in concrete from a height of more than 3 ft. high are being started again.
3. Perhaps you have not observed that the R.C. edges to practically all columns in the 2nd floor and some on the north wing on the ground floor fall off at the time of knocking of the shuttering. This is due to insufficient cement in the mixture as it escaped during the placing of concrete because of non-water tightness of the shutterings.
4. One or two cloumns in the second floor look awfull at the point where the R.C. wall plates meet. The temporary joints are noticeable and honeycombs all over. In places the aggregate can be seen. This too is caused by the non-water-tightness at the shuttering.
5. I would remind you to submit the plan of the variations from the approved plan early for the Boards consideration.


(Azman bin Hj. A. Hamid)
SECRETARY
TOWN BOARD MUAR.

Copy to:-

Mr. Kamille Abdue.
Supervisor of New Chinese School
at Jalan Junid, Muar.
No: 13A. Jalan Junid, Muar.